


Оправки с конусом 7/24 для станков с ЧПУ (DIN69871 A)

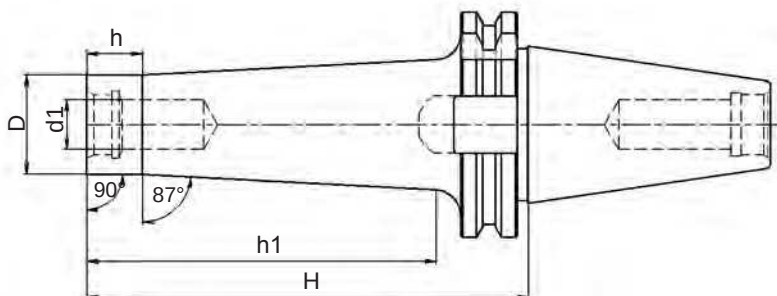

TH-NC40...G...H

Обозначение	Размеры, мм					
	NC	d1	D	h	H	h1
TH-NC40G08H045	40	M08	14,5	10	45	17
TH-NC40G08H070	40	M08	14,5	10	70	45
TH-NC40G08H095	40	M08	14,5	10	95	67
TH-NC40G08H120	40	M08	14,5	10	120	95
TH-NC40G10H050	40	M10	18,5	10	50	22
TH-NC40G10H075	40	M10	18,5	10	75	50
TH-NC40G10H100	40	M10	18,5	10	100	72
TH-NC40G10H125	40	M10	18,5	10	125	100
TH-NC40G10H150	40	M10	18,5	10	150	125
TH-NC40G12H060	40	M12	22	10	60	32
TH-NC40G12H085	40	M12	22	10	85	60
TH-NC40G12H110	40	M12	22	10	110	82
TH-NC40G12H135	40	M12	22	10	135	110
TH-NC40G12H160	40	M12	22	10	160	135
TH-NC40G16H040	40	M16	28	10	40	17
TH-NC40G16H065	40	M16	28	10	65	37
TH-NC40G16H090	40	M16	28	10	90	65
TH-NC40G16H115	40	M16	28	10	115	90
TH-NC40G16H140	40	M16	28	10	140	115
TH-NC40G16H165	40	M16	28	10	165	140

TH-NC50...G...H

TH-NC50G12H050	50	M12	22	10	50	25
TH-NC50G12H100	50	M12	22	10	100	75
TH-NC50G12H150	50	M12	22	10	150	128
TH-NC50G12H200	50	M12	22	10	200	175
TH-NC50G16H050	50	M16	28	10	50	25
TH-NC50G16H100	50	M16	28	10	100	75
TH-NC50G16H150	50	M16	28	10	150	125
TH-NC50G16H200	50	M16	28	10	200	175
TH-NC50G16H250	50	M16	28	10	250	228
TH-NC50G20H075	50	M20	36,2	10	75	50
TH-NC50G20H100	50	M20	36,2	10	100	75
TH-NC50G20H150	50	M20	36,2	10	150	125
TH-NC50G20H200	50	M20	36,2	10	200	175
TH-NC50G24H095ADB	50	M24	45	20	95	72
TH-NC50G24H228ADB	50	M24	45	54	228,75	193,7