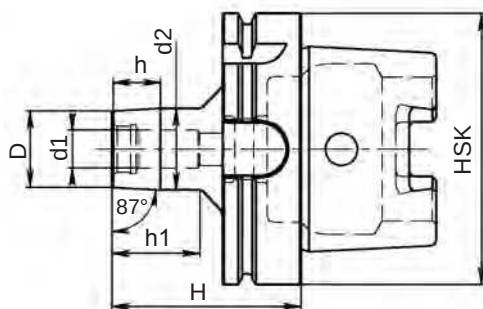


Оправки с конусом HSK DIN 69893 Form A

**TH-HA063...G...H** $n_{max} = 8\,000 \text{ об/мин}$

Обозначение	Размеры, мм						
	HSK	d1	d2	D	h	H	h1
TH-HA063G08H045	63	M 8	15,5	14,5	10	45	14
TH-HA063G08H070	63	M 8	15,5	14,5	10	70	39
TH-HA063G08H095	63	M 8	15,5	14,5	10	95	64
TH-HA063G08H120	63	M 8	15,5	14,5	10	120	85
TH-HA063G10H050	63	M 10	19,5	18,5	10	50	16
TH-HA063G10H075	63	M 10	19,5	18,5	10	75	41
TH-HA063G10H100	63	M 10	19,5	18,5	10	100	66
TH-HA063G10H125	63	M 10	19,5	18,5	10	125	91
TH-HA063G10H150	63	M 10	19,5	18,5	10	150	116
TH-HA063G12H060	63	M 12	23	22	10	60	26
TH-HA063G12H085	63	M 12	23	22	10	85	51
TH-HA063G12H110	63	M 12	23	22	10	110	76
TH-HA063G12H135	63	M 12	23	22	10	135	101
TH-HA063G12H160	63	M 12	23	22	10	160	126
TH-HA063G16H065	63	M 16	30	28	19	65	31
TH-HA063G16H090	63	M 16	30	28	19	90	59
TH-HA063G16H115	63	M 16	30	28	19	115	81
TH-HA063G16H140	63	M 16	30	28	19	140	109
TH-HA063G16H165	63	M 16	30	28	19	165	134

TH-HA100...G...H $n_{max} = 8\,000 \text{ об/мин}$

TH-HA100G12H055	100	M 12	23	22	10	55	21
TH-HA100G12H100	100	M 12	23	22	10	100	60
TH-HA100G12H150	100	M 12	23	22	10	150	110
TH-HA100G12H200	100	M 12	23	22	10	200	156
TH-HA100G16H060	100	M 16	30	28	19	60	21
TH-HA100G16H100	100	M 16	30	28	19	100	60
TH-HA100G16H150	100	M 16	30	28	19	150	110
TH-HA100G16H200	100	M 16	30	28	19	200	156
TH-HA100G16H250	100	M 16	30	28	19	250	206