


*Патроны сверлильные высокоточные 7/24 DIN 69871*

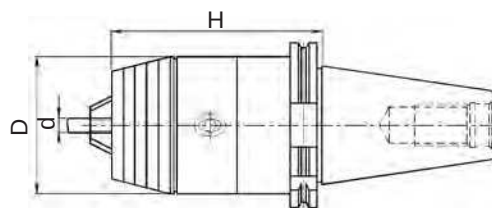


**TH-NC40...D...H**

| Обозначение    | Размеры, мм |       |    |    |
|----------------|-------------|-------|----|----|
|                | NC          | d     | D  | H  |
| TH-NC40D08H070 | 40          | 0,5-8 | 36 | 70 |
| TH-NC40D13H090 | 40          | 1-13  | 50 | 90 |
| TH-NC40D16H090 | 40          | 3-16  | 57 | 90 |

**TH-NC50...D...H**

|                |    |      |    |     |
|----------------|----|------|----|-----|
| TH-NC50D13H110 | 50 | 1-13 | 50 | 110 |
| TH-NC50D16H110 | 50 | 3-16 | 57 | 110 |

*Патроны цанговые 7/24 DIN 69871 системы OZ*

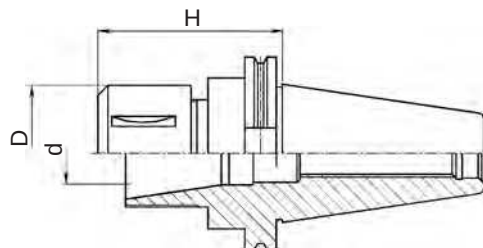

**TH-NC40...Z...H**


| Обозначение    | Размеры, мм |      |    |     | Цанга |
|----------------|-------------|------|----|-----|-------|
|                | NC          | d    | D  | H   |       |
| TH-NC40Z16H070 | 40          | 2-16 | 43 | 70  | OZ 16 |
| TH-NC40Z25H070 | 40          | 2-25 | 60 | 70  | OZ 25 |
| TH-NC40Z25H120 | 40          | 2-25 | 60 | 120 | OZ 25 |
| TH-NC40Z32H090 | 40          | 3-32 | 72 | 90  | OZ 32 |

**TH-NC50...Z...H**

|                |    |      |    |     |       |
|----------------|----|------|----|-----|-------|
| TH-NC50Z25H070 | 50 | 2-25 | 60 | 70  | OZ 25 |
| TH-NC50Z32H080 | 50 | 3-32 | 72 | 80  | OZ 32 |
| TH-NC50Z32H120 | 50 | 3-32 | 72 | 120 | OZ 32 |

Выбор цанги стр. 141

*Патроны резьбонарезные 7/24 DIN 69871*

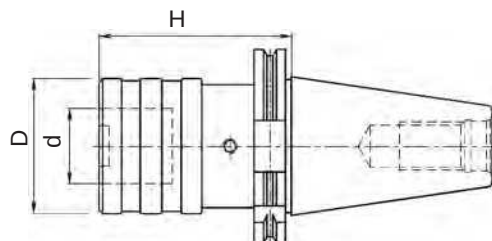

**TH-NC40...M-M**

| Обозначение    | Размеры, мм |    |    |     | Размер | Резьба  |
|----------------|-------------|----|----|-----|--------|---------|
|                | NC          | d  | D  | H   |        |         |
| TH-NC40M3-M12  | 40          | 19 | 38 | 60  | 1      | M3-M12  |
| TH-NC40M8-M20  | 40          | 31 | 53 | 100 | 2      | M8-M20  |
| TH-NC40M14-M32 | 40          | 48 | 78 | 138 | 3      | M14-M32 |

**TH-NC50...M-M**

|                |    |    |    |     |   |         |
|----------------|----|----|----|-----|---|---------|
| TH-NC50M3-M12  | 50 | 19 | 38 | 60  | 1 | M3-M12  |
| TH-NC50M8-M20  | 50 | 31 | 53 | 100 | 2 | M8-M20  |
| TH-NC50M14-M32 | 50 | 48 | 78 | 140 | 3 | M14-M32 |

Вставки  
резьбонарезные стр. 142