



Втулки переходные с 7/24 MAS BT 403 на 7/24 DIN 2080, DIN 69871, MAS BT 403

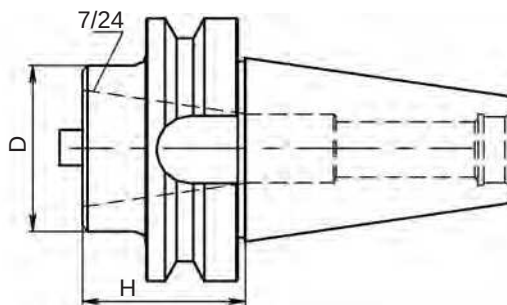

**TH-BT50...H**

| Обозначение     | Размеры, мм |      |    |    |
|-----------------|-------------|------|----|----|
|                 | BT          | 7/24 | D  | H  |
| TH-BT50SK40H070 | 50          | SK40 | 70 | 70 |
| TH-BT50NC40H070 | 50          | NC40 | 70 | 70 |
| TH-BT50BT40H070 | 50          | BT40 | 70 | 70 |

Патроны сверлильные высокоточные 7/24 MAS BT 403

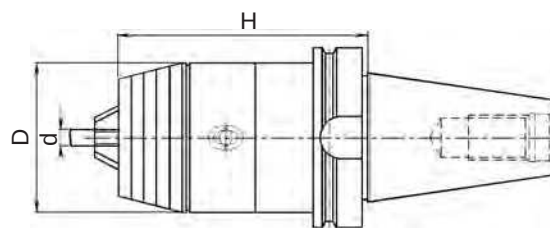


**TH-BT40...D...H**

| Обозначение    | Размеры, мм |       |    |    |
|----------------|-------------|-------|----|----|
|                | BT          | d     | D  | H  |
| TH-BT40D08H078 | 40          | 0,5-8 | 36 | 78 |
| TH-BT40D13H098 | 40          | 1-13  | 50 | 98 |
| TH-BT40D16H098 | 40          | 3-16  | 57 | 98 |

**TH-BT50...D...H**

|                |    |      |    |     |
|----------------|----|------|----|-----|
| TH-BT50D13H110 | 50 | 1-13 | 50 | 110 |
| TH-BT50D16H110 | 50 | 3-16 | 57 | 110 |

Патроны цанговые 7/24 MAS BT 403 системы OZ

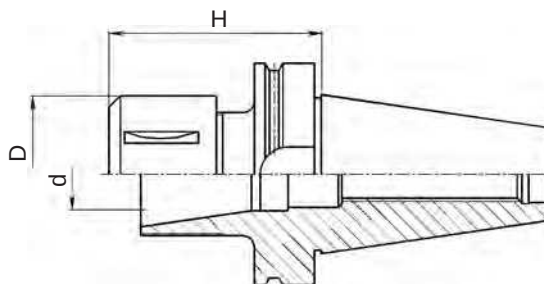

**TH-BT40...Z...H**

| Обозначение    | Размеры, мм |      |    |     | Цанга |
|----------------|-------------|------|----|-----|-------|
|                | BT          | d    | D  | H   |       |
| TH-BT40Z16H070 | 40          | 2-16 | 43 | 70  | OZ 16 |
| TH-BT40Z25H070 | 40          | 2-25 | 60 | 70  | OZ 25 |
| TH-BT40Z25H120 | 40          | 2-25 | 60 | 120 | OZ 25 |
| TH-BT40Z32H090 | 40          | 3-32 | 72 | 90  | OZ 32 |

**TH-BT50...Z...H**

|                |    |      |    |    |       |
|----------------|----|------|----|----|-------|
| TH-BT50Z25H070 | 50 | 2-25 | 60 | 70 | OZ 25 |
| TH-BT50Z32H090 | 50 | 3-32 | 72 | 90 | OZ 32 |

Выбор цанги

стр. 141